



---

TECHNICAL NOTE No. 001-2005

27-01-2005


---

**MODEL: V11 Ballabio – Cafè Sport – Cat 2003-2005**

**SUBJECT: New tachometer cable**

Dear Dealer,

We have ascertained that on the above vehicles, that are equipped with the return cable for the throttle cable (part no. 01603380), the tachometer cable might break due to the angle with which it is fixed to the engine (1). (Picture 1)

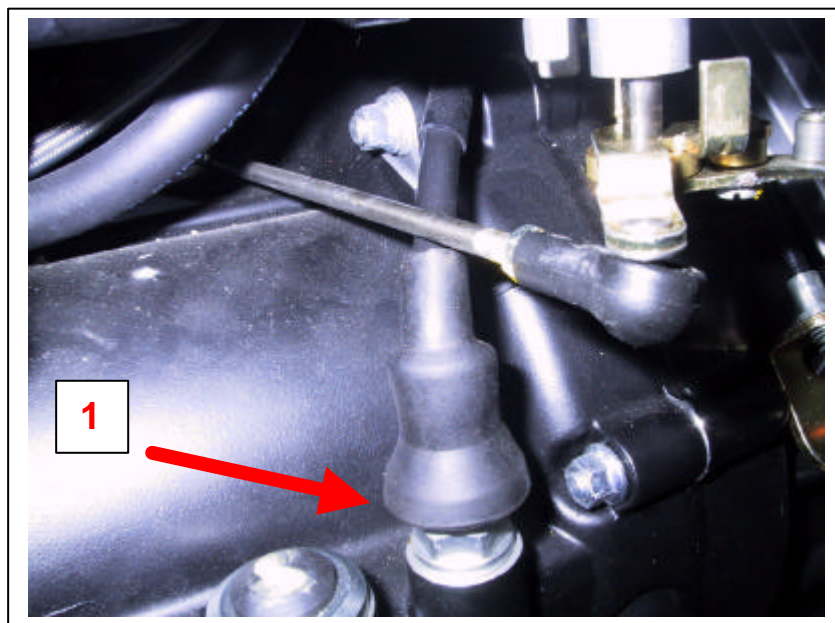


Picture 1

In case the cable needs replacing, spare new cables are available part no. 01760481 (supersedes part no. 01760480) and part no. 01760492 (supersedes part no. 01760491), that are fitted to the engine at a wider angle (20°).




When fitting the cable, turn metal fitting (1) so to set maximum distance (2) between tachometer cable and throttle body linkage (minimum 5 mm). (Picture 2)

Should it be impossible to obtain specified distance, change throttle body position: loosen the clips on rubber hoses and position the throttle body in such a way as to ensure the minimum distance required between tachometer cable and throttle body linkage.

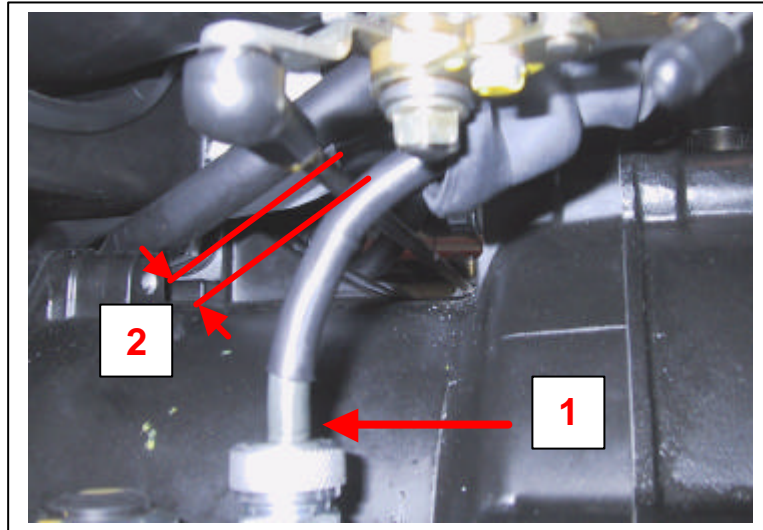

Picture 2

Ensure the tachometer cable is correctly in place: it **should be routed at the left of the throttle body linkage**, it is recommended to tie the cable to it to keep it in position; do not tighten too much. (Picture 3)

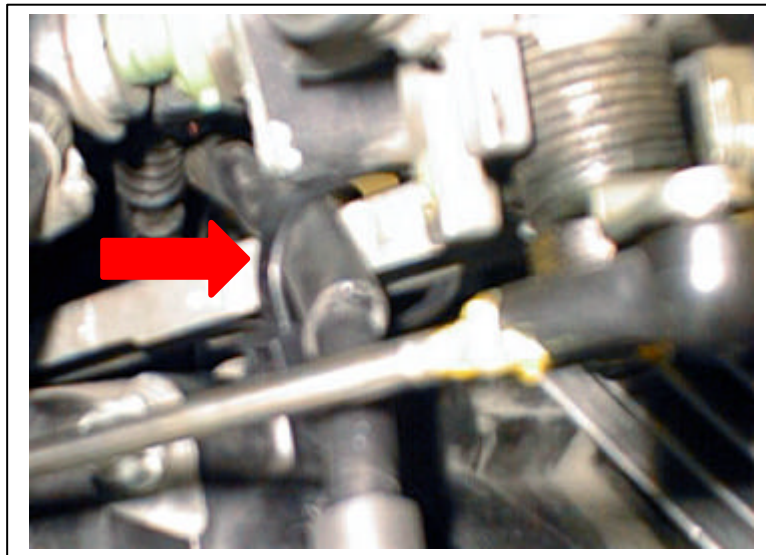

Picture 3

Best regards